


Code: **G86**

Guide Bush, Bronze
CNOMO / PSA

Heat Resistance: < 150°C

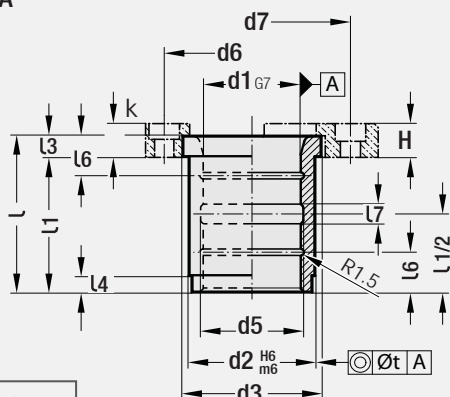


Order: **G86. d1 x l**

d1 mm	l mm	d2 mm	d3 mm	d5 mm	d6 G102E	d7 G118	l1 mm	l3 mm	l4 mm	l6 mm	l7 mm	h mm	k mm
20	32	28	32	22	-	-	28	4	3	-	5	10	-
25	40	35	40	27	-	-	35	5	5	-	5	10	-
32	50	44	50	34	-	-	44	6	8	12	5	12	-
40	63	52	60	42	73.4	82	55	8	8	16	8	12	12
50	80	63	71	52	87.4	98	70	10	8	20	10	16	16
63	100	80	90	65	110.4	115	88	12	10	25	12	20	20
80	125	100	112	82	132.4	144	109	16	10	32	16	25	25
100	160	125	140	102	160.4	170	140	20	10	40	20	32	32

Guide Bush, Headed - CNOMO
Self-Lubricating

Code: **G43**


Heat Resistance: < 150°C

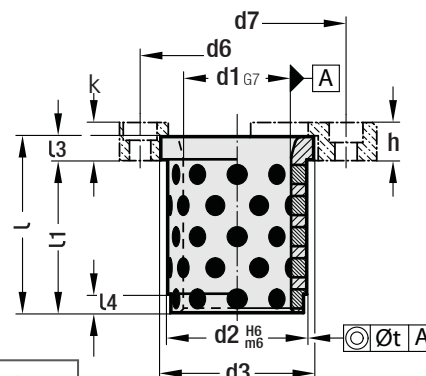

Order: **G43. d1 x l**

d1 mm	l mm	d2 mm	d3 mm	d6 G102E	d7 G118	l1 mm	l3 mm	l4 mm	h mm	k mm	(A)t
20	32	28	32	-	-	28	4	3	10	-	0.01
25	40	35	40	-	-	35	5	5	10	-	0.01
32	50	44	50	-	-	44	6	5	12	-	0.01
40	63	52	60	73.4	82	55	8	8	12	12	0.02
50	80	63	71	87.4	98	70	10	8	16	16	0.02
63	100	80	90	110.4	115	88	12	10	20	20	0.02
80	125	100	112	132.4	144	109	16	10	25	25	0.02
100	160	125	140	160.4	170	140	20	10	32	32	0.02

Bush Holder Flange

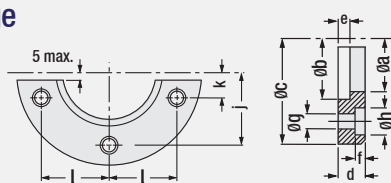


Order: **G118. Bush**

Code: **G118**

Bush	a	b	c	d	e	f	g	h	j	k	l
25	32	41	72	10	5	7	6.6	12	-	20	20
32	40	51	80	12	6	7	6.6	12	-	21	25
40	50	61	100	12	8	7	6.6	12	41	14	38.5
50	63	72	125	16	10	9	9	16	49	17	46
63	80	91	140	20	12	11	11	18	57.5	17	55
80	100	113	180	25	16	13	14	22	72	20	70
100	125	141	200	32	20	13	14	22	85	25	81

Bush Clamp
CNOMO

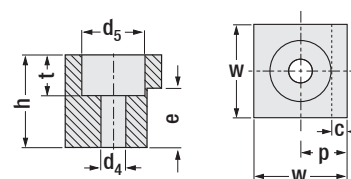

Order: **G102E. Bush**

FORM - E

Code: **G102E**

Bush	w	p	h	e	c	t	d4	d5
Ø 40	18	9.5	12	8	3	7	6.6	11
Ø 50	22	12	16	10	4	9	9	15
Ø 63	26	15	20	12	5	11	11	18
Ø 80	26	15	25	16	5	11	11	18
Ø 100	26	15	32	20	5	11	11	18

Note: Used with G03 / G43 guide pillars and bushes. Instead of this clamp in these standards, the clamps with code nr. G102 may be used.